




Mounting Instruction Plug F3430 + Cable RG11

- 1) Remove the cable sheath




- 2) Push back the braided shield and strip the isolation from the center conductor

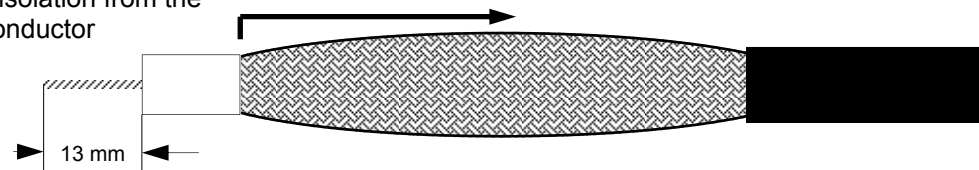

- 3) Push back the screen to the front and twist it together on the front end




- 4) Put the rear screw and the collet on the cable

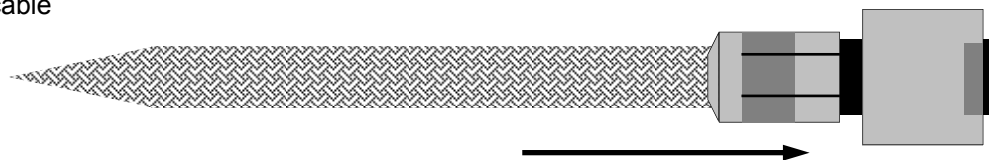

- 5) Push back the braided shield and cut it along the outside of the taper washer



- 6) Put on the isolation sleeve and the connector case and screw them together

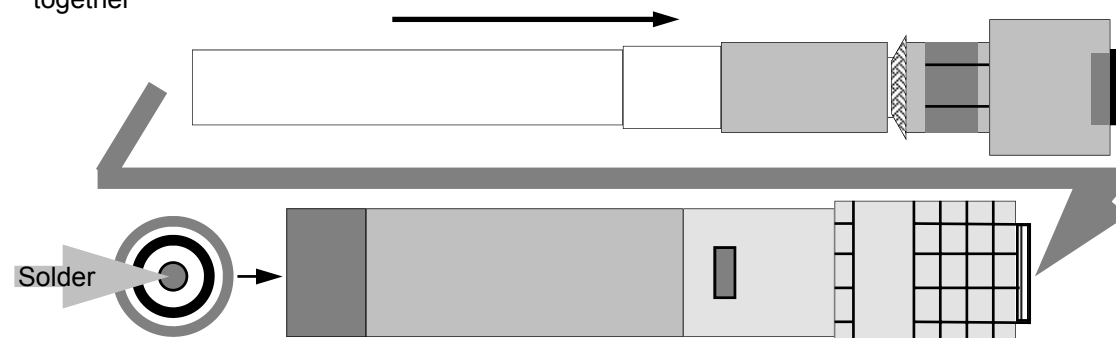


- 7) Solder the cable center conductor with the plug center contact

SC 01/2008




Mounting Instruction SHV Cable Jack + Cable RG58

- 1) Remove the cable sheath

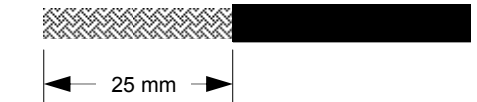

- 2) Push back the braided shield and strip the isolation from the center conductor

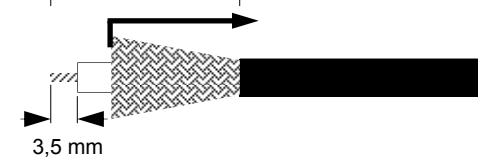


- 3) Push back the screen to the front end and twist it together




- 4) Put on the cable the screws, metal washer, clamping rubber and taper washer




- 5) Push back the braided shield and cut it along the outside of the taper washer

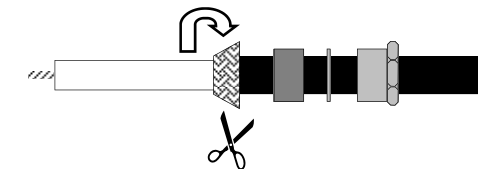

- 6) Solder the center contact

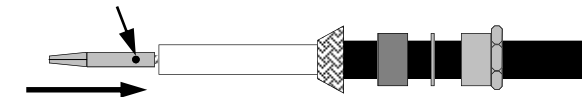

- 7) Push the parts together and screw them together

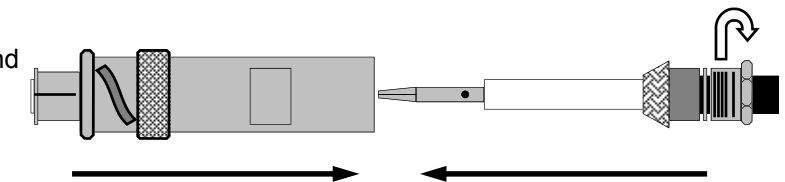


SC 01/2008




Mounting Instruction Plug HS21 + Cable 130660


- 1) Put on the cable the sleeve nut, screws, metal washer, clamping rubber and taper washer

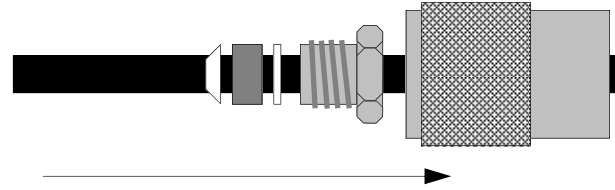

- 2) Remove the cable sheath

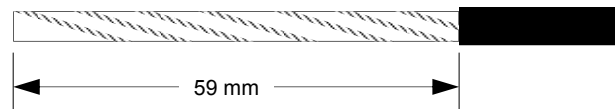


- 3) Push back the shield wires, shorten them to approx. 5 mm, remove the foil and strip the isolation from the center conductor

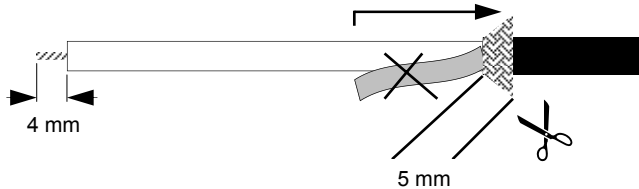

- 4) Solder the center contact




- 5) Put on the plug sleeve and fix the center contact

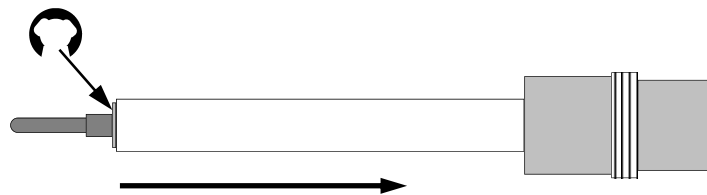

- 6) Push the parts together and screw them together

Pay attention to a good clamping of the screen !

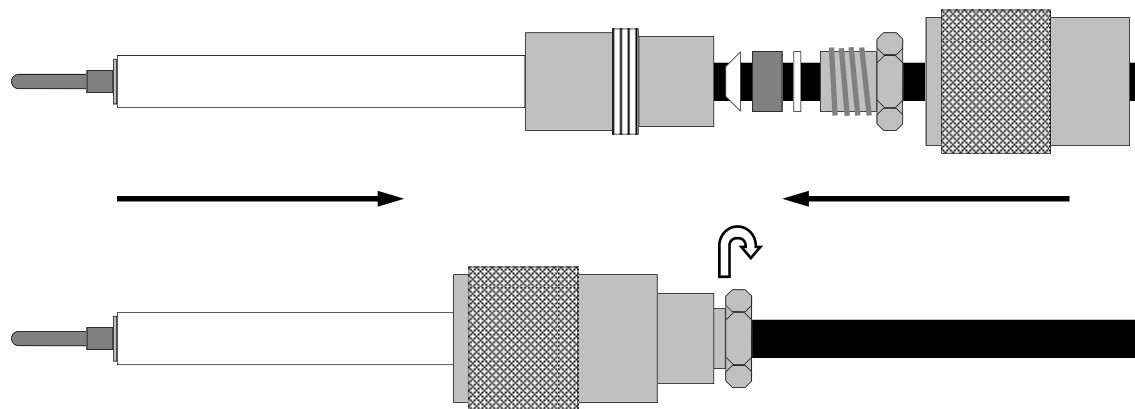

SC 01/2008




Mounting Instruction Plug F3415 + Cable 130660


- 1) Remove the cable sheath




- 2) Push back the shield wires, remove the foil and strip the isolation from the center conductor

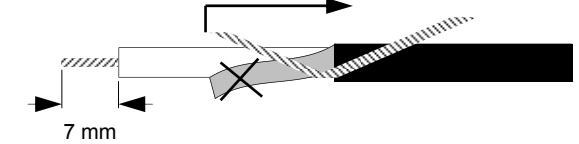


- 3) Put on the cable the rear part, the collet and the clamping sleeve

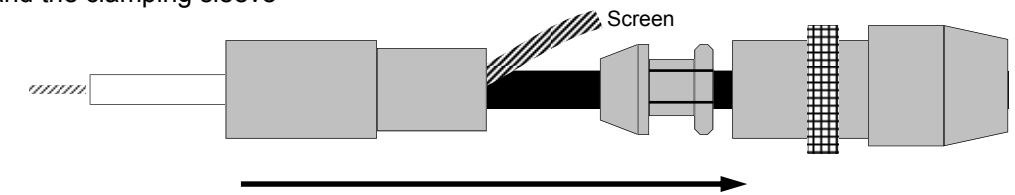


- 4) Put on the plastic sleeve with center contact and solder the contact

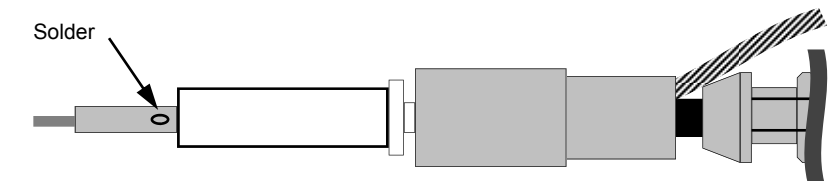

- 5) Push the plug case, the plastic sleeve and the other parts together

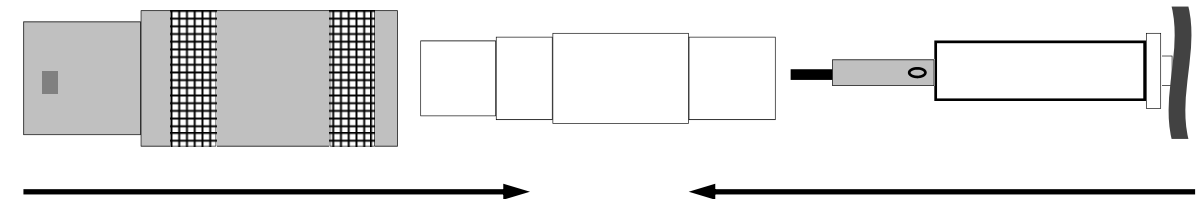

- 6) Cut overhanging screen wires and screw the plug components together

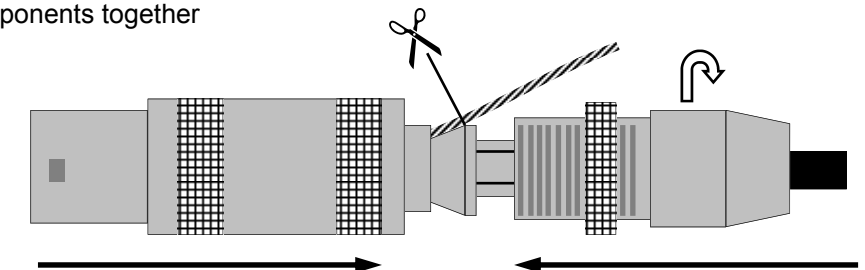

SC 01/2008